

Division of Health Service Regulation

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: HAL092115	(X2) MULTIPLE CONSTRUCTION A. BUILDING: 01 B. WING: _____	(X3) DATE SURVEY COMPLETED 09/29/2016
NAME OF PROVIDER OR SUPPLIER COVENTRY HOUSE OF ZEBULON		STREET ADDRESS, CITY, STATE, ZIP CODE 1225 W GANNON AVENUE ZEBULON, NC 27597		
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETE DATE
C 000	Initial Comments Report of a Biennial Construction Survey by Frank Strickland and Billy Bryant on 09/29/2016: Records indicate this facility was first licensed on 06/15/1997 as a HA. The facility is currently licensed for 60 Beds. Therefore, this facility was surveyed for conformance with the applicable portions of the 2005 Rules for Licensing of Adult Care Homes of Seven or More Beds and applicable portions of the 1996 (1997 Revision) Edition, of the North Carolina Building Code(s), Institutional Occupancy, and the 1996 Minimum Standards and Regulations for Homes for the Aged in effect at time of initial licensure. Deficiencies have been cited and a Plan of Correction is required.	C 000		
C 164	Housekeeping and Furnishings-Clean, Repaired SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0306 HOUSEKEEPING AND FURNISHINGS (a) Adult care homes shall: (1) have walls, ceilings, and floors or floor coverings kept clean and in good repair; (2) have no chronic unpleasant odors; (3) have furniture clean and in good repair; (e) This Rule shall apply to new and existing facilities. This Rule is not met as evidenced by: 1-Based on observation, this facility has failed to maintain the finishes on ceiling surfaces in areas that serve food to the residents. Findings on 09/29/2016: The ceilings in the Dining Hall have finishes that have failed due to previous water migration from	C 164	The Facility will have all finishes on ceiling in dining hall repaired in a reasonable time (30 days)	11/30/16

Division of Health Service Regulation

LABORATORY DIRECTOR'S OR PROVIDER/SUPPLIER REPRESENTATIVE'S SIGNATURE

TITLE

(X6) DATE

STATE FORM

5859

JW3H21

If continuation sheet 1 of 5

Division of Health Service Regulation

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: HAL092115	(X2) MULTIPLE CONSTRUCTION A. BUILDING: 01 B. WING: _____		(X3) DATE SURVEY COMPLETED 09/29/2016
NAME OF PROVIDER OR SUPPLIER COVENTRY HOUSE OF ZEBULON		STREET ADDRESS, CITY, STATE, ZIP CODE 1225 W GANNON AVENUE ZEBULON, NC 27597			
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)		(X5) COMPLETE DATE
C 164	Continued From page 1 the attic and need repair. 2-Based on observation, this facility has failed to maintain the operation and service of interior door. Findings on 09/29/2016: The interior door in the Utility Room has missing door hardware that prevents the from latching. 3-Based on observation, this facility has failed to maintain the operation and service of plumbing fixtures. Findings on 09/29/2016: The toilet is loose that is located Men's Bathroom across the hall from the Nurse's Station. 4-Based on observation, this facility has failed to maintain the mechanical exhaust components. Findings on 09/29/2016: The exhaust duct has become unfastened to the ceiling housing that is located in Room 407.	C 164	door Hardware is now installed on utility room door -tag C-164 10/7/16 the toilet located in Men's Bathroom across nursing station is now secure. tag C-164 10/7/16 The exhaust duct was securely fastened to ceiling housing located in room 407 Tag C164 10/7/16		
C 189	Building Equipment Maintained Safe, Operating SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0311 OTHER REQUIREMENTS (a) The building and all fire safety, electrical, mechanical, and plumbing equipment in an adult care home shall be maintained in a safe and operating condition. (k) This Rule shall apply to new and existing facilities with the exception of Paragraph (e) which shall not apply to existing facilities.	C 189			

Division of Health Service Regulation

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: HAL092115	(X2) MULTIPLE CONSTRUCTION A. BUILDING: 01 B. WING: _____	(X3) DATE SURVEY COMPLETED 09/29/2016
NAME OF PROVIDER OR SUPPLIER COVENTRY HOUSE OF ZEBULON		STREET ADDRESS, CITY, STATE, ZIP CODE 1225 W GANNON AVENUE ZEBULON, NC 27597		
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETE DATE
C 189	Continued From page 2 This Rule is not met as evidenced by: 1-Based on observation, this facility has failed to post documentation as required by the NC State Building Code regarding to Special Locking Systems. Findings on 09/29/2016: A wiring diagram and special locking system components location map shall be posted under glass adjacent to the FACP. 2-Based on observations, this facility has not been maintained penetrations due to breaches through fire-rated construction invalidated its integrity of ceiling construction. This could affect all residents and staff in the event that a fire and/or smoke is not contained in a room or compartment of origin. Findings on 09/29/2016: There is a hole in the ceiling filled with foam that is not fire-resistant that is located in the outside Mechanical Room. 3-Based on observations, this facility has not been maintained penetrations due to breaches through fire-rated construction invalidated its integrity of ceiling construction. This could affect all residents and staff in the event that a fire and/or smoke is not contained in a room or compartment of origin. Findings on 09/29/2016: The sheet-rock ceiling has been damaged due to the installation of a new pressure gauge on the sprinkler riser that is located in the Sprinkler Riser Room. 4-Based on observations, this facility has failed to	C 189	Wiring diagram + special locking system component map placed under glass near FACP Carolina Fire Protection called and a visit scheduled to come out and repair ceiling done by installation of new pressure gauge on sprinkler riser.	10/25/16 11/30/16

If continuation sheet 4 of 5

Division of Health Service Regulation

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: HAL092115	(X2) MULTIPLE CONSTRUCTION A. BUILDING: 01 B. WING _____		(X3) DATE SURVEY COMPLETED 09/29/2016
NAME OF PROVIDER OR SUPPLIER COVENTRY HOUSE OF ZEBULON		STREET ADDRESS, CITY, STATE, ZIP CODE 1225 W GANNON AVENUE ZEBULON, NC 27597			
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)		(X5) COMPLETE DATE
C 199	Continued From page 4 400 Halls.	C 199			