

Division of Health Service Regulation

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: HAL054051	(X2) MULTIPLE CONSTRUCTION A. BUILDING: 01 B. WING _____	(X3) DATE SURVEY COMPLETED R 04/18/2018
NAME OF PROVIDER OR SUPPLIER LENOIR ASSISTED LIVING		STREET ADDRESS, CITY, STATE, ZIP CODE 2773 PINWOOD HOME ROAD PINK HILL, NC 28572		
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETE DATE
{C 000}	Initial Comments Report of a Biennial Follow Up Construction Survey by Ed Miller, conducted on April 18, 2018. Deficiencies were cited that will require a new Plan of Correction.	{C 000}		
{C 189}	Building Equipment Maintained Safe, Operating SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0311 OTHER REQUIREMENTS (a) The building and all fire safety, electrical, mechanical, and plumbing equipment in an adult care home shall be maintained in a safe and operating condition. (k) This Rule shall apply to new and existing facilities with the exception of Paragraph (e) which shall not apply to existing facilities. This Rule is not met as evidenced by: 1. Based on observation there is a failure to maintain the building's fire safety systems in a safe condition. Holes or gaps at penetrations through fire resistant rated ceilings could allow fire and smoke to spread beyond the area of origin. Findings on 4-18-2018: d. Main Electrical room: 1) There are multiple unsealed or incomplete ceiling penetrations. 2) Unapproved orange foam was covered over with a thin layer of firestop sealant. Through penetrations shall be protected by an approved penetration firestop system installed as tested in accordance with ASTM E 814 or UL 1479. 5. Based on observation there is a failure to	{C 189}		

Division of Health Service Regulation

LABORATORY DIRECTOR'S OR PROVIDER/SUPPLIER REPRESENTATIVE'S SIGNATURE

TITLE

(X6) DATE

Division of Health Service Regulation

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: HAL054051	(X2) MULTIPLE CONSTRUCTION A. BUILDING: 01 B. WING _____		(X3) DATE SURVEY COMPLETED R 04/18/2018
NAME OF PROVIDER OR SUPPLIER LENOIR ASSISTED LIVING			STREET ADDRESS, CITY, STATE, ZIP CODE 2773 PINWOOD HOME ROAD PINK HILL, NC 28572		
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETE DATE	
{C 189}	Continued From page 1 maintain the facility's fire safety equipment in a safe operating condition. Occupants in the smoke compartment could be exposed to smoke or fire if doors do not completely close and latch to help limit the spread of smoke or fire to the area of origin. New findings on 4-18-2018: a. The astragal was loose on the smoke barrier doors near room 400.	{C 189}			