

Division of Health Service Regulation

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION	(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: HAL001028	(X2) MULTIPLE CONSTRUCTION A. BUILDING: 01 B. WING: _____	(X3) DATE SURVEY COMPLETED 09/19/2023
---	---	--	--

NAME OF PROVIDER OR SUPPLIER

BROOKDALE BURLINGTON

STREET ADDRESS, CITY, STATE, ZIP CODE

**3619 SOUTH MEBANE STREET
BURLINGTON, NC 27215**

(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETE DATE
C 000	Initial Comments Report of a Construction Section Biennial Survey by Tod Hancock, conducted on September 19, 2023. Records indicate this facility was first licensed on December 10, 2000. The facility is currently licensed as a 52 Bed Special Care Unit. Therefore, the facility was surveyed for conformance with the 2005 Rules for Licensing of Adult Care Homes of Seven or More Beds and applicable portions of the 1996 (1999) Edition of the North Carolina Building Code(s), Institutional Occupancy, and the 1996 Rules for Licensing of Adult Care Homes of Seven or More Beds in effect at the time of initial licensure. Deficiencies were cited that require a Plan of Correction.	C 000		
C 111	Must Have Current San. & Fire Safety Reports SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0302 DESIGN AND CONSTRUCTION(f) The facility shall have current sanitation and fire and building safety inspection reports which shall be maintained in the home and available for review. This Rule is not met as evidenced by: 1. Based on record review and interview with staff, the facility failed to maintain in the facility, current (completed within the last twelve months) annual inspection report(s) required by this rule. Findings September 19, 2023: a. There were no records available to indicate the Fire Alarm system had been inspected. b. There were no records available to indicate the Fire Sprinkler system had been inspected.	C 111	Have records of inspection Sept 19 2023	Sept. 26 2023

Division of Health Service Regulation

LABORATORY DIRECTOR'S OR PROVIDER/SUPPLIER REPRESENTATIVE'S SIGNATURE

TITLE

(X6) DATE

Division of Health Service Regulation

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: HAL001028	(X2) MULTIPLE CONSTRUCTION A. BUILDING: 01 B. WING: _____		(X3) DATE SURVEY COMPLETED 09/19/2023
NAME OF PROVIDER OR SUPPLIER BROOKDALE BURLINGTON			STREET ADDRESS, CITY, STATE, ZIP CODE 3619 SOUTH MEBANE STREET BURLINGTON, NC 27215		
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETE DATE	
C 188	Electrical Outlets in Wet Locations SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0310 ELECTRICAL OUTLETS All adult care home electrical outlets in wet locations at sinks, bathrooms and outside of building shall have ground fault interrupters. This Rule is not met as evidenced by: 1. Based on observation the facility is not maintaining the electrical components located near water a water source in a safe manner. Findings September 19, 2023: b. Laundry- The receptacle behind the washing machine did not trip on test indicating the lack of ground fault protection. c. C Hall Laundry- The receptacle behind the washing machine did not trip on test indicating the lack of ground fault protection. d. AB Hall Laundry- The receptacle behind the washing machine did not trip on test indicating the lack of ground fault protection. e. D Hall Janitors Closet- The receptacle adjacent to a water supplied fixture did not trip on test indicating the lack of ground fault protection.	C 188	<i>replace receptacle</i>	<i>Nov. 2023</i>	
C 189	Building Equipment Maintained Safe, Operating SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0311 OTHER REQUIREMENTS (a) The building and all fire safety, electrical, mechanical, and plumbing equipment in an adult care home shall be maintained in a safe and operating condition.	C 189			

Division of Health Service Regulation

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: HAL001028	(X2) MULTIPLE CONSTRUCTION A. BUILDING: 01 B. WING: _____	(X3) DATE SURVEY COMPLETED 09/19/2023
NAME OF PROVIDER OR SUPPLIER BROOKDALE BURLINGTON		STREET ADDRESS, CITY, STATE, ZIP CODE 3619 SOUTH MEBANE STREET BURLINGTON, NC 27215		
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETE DATE
C 189	Continued From page 2 (k) This Rule shall apply to new and existing facilities with the exception of Paragraph (e) which shall not apply to existing facilities. This Rule is not met as evidenced by: 1. Based on observation, the building's emergency equipment is not maintained in a safe and operating condition. This could affect all if they could not promptly find their way to the exit during an emergency. a. Room 90- The exit light did not illuminate when tested. 2. Based on observation the building's sprinkler system was not maintained in a safe and operating condition. This would affect all if the fire was not contained in the room of origin. Findings September 19, 2023: a. Entrance Portico- (3) Sprinkler escutcheon plates are missing. The exposed opening would allow smoke and fire into the attic.	C 189	Summit Fire Safety replace plates	Oct, 2023
C 199	Exhaust Ventilation SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0311 OTHER REQUIREMENTS (g) The spaces listed in this Paragraph shall be provided with exhaust ventilation at the rate of two cubic feet per minute per square foot. This requirement does not apply to facilities licensed before April 1, 1984, with natural ventilation in these specified spaces: (1) soiled linen storage; (2) soil utility room; (3) bathrooms and toilet rooms; (4) housekeeping closets; and (5) laundry area.	C 199		

Division of Health Service Regulation

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: HAL001028	(X2) MULTIPLE CONSTRUCTION A. BUILDING: 01 B. WING _____	(X3) DATE SURVEY COMPLETED 09/19/2023
NAME OF PROVIDER OR SUPPLIER BROOKDALE BURLINGTON		STREET ADDRESS, CITY, STATE, ZIP CODE 3619 SOUTH MEBANE STREET BURLINGTON, NC 27215		
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETE DATE
C 199	Continued From page 3 (k) This Rule shall apply to new and existing facilities with the exception of Paragraph (e) which shall not apply to existing facilities. This Rule is not met as evidenced by: 1.Observation revealed that the facility did not maintain exhaust ventilation in specified spaces. Lack of ventilation allows for the accumulation of humidity that can cause bacterial growth and prevent the dissipation of odors. Findings September 19, 2023: a. Laundry- The exhaust fan is not working. b. C Hall Laundry- The exhaust fan is not working.	C 199		