

Division of Health Service Regulation

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: HAL027003	(X2) MULTIPLE CONSTRUCTION A. BUILDING: 01 B. WING _____	(X3) DATE SURVEY COMPLETED R 06/19/2024
NAME OF PROVIDER OR SUPPLIER CURRITUCK HOUSE		STREET ADDRESS, CITY, STATE, ZIP CODE 141 MOYOCK LANDING DRIVE MOYOCK, NC 27958		
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETE DATE
{C 000}	Initial Comments Report of a Biennial Follow Up Construction Survey by Suzanna Fay conducted on June 19, 2024. There are deficiencies from the Biennial Construction Survey that remain to be corrected.	{C 000}		
{C 101}	Existing Licensed Fac- No less than '71 Rules SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0301 APPLICATION OF PHYSICAL PLANT REQUIREMENTS The physical plant requirements for each adult care home shall be applied as follows: (2) Except where otherwise specified, existing licensed facilities or portions of existing licensed facilities shall meet licensure and code requirements in effect at the time of construction, change in service or bed count, addition, renovation, or alteration; however in no case shall the requirements for any licensed facility where no addition or renovation has been made, be less than those requirements found in the 1971 "Minimum and Desired Standards and Regulations" for "Homes for the Aged and Infirm", copies of which are available at the Division of Health Service Regulation at no cost; This Rule is not met as evidenced by: 1. Observations revealed that the facility does not meet licensure and code requirements in effect at the time of construction, change in service or bed count, addition, renovation or alteration. Electromagnetic locks shall have an on/off emergency release switch capable of interrupting power to all electromagnetically locked doors in the facility. Release switches shall be located and properly identified at each	{C 101}		

Division of Health Service Regulation

LABORATORY DIRECTOR'S OR PROVIDER/SUPPLIER REPRESENTATIVE'S SIGNATURE

TITLE

(X6) DATE

Division of Health Service Regulation

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: HAL027003	(X2) MULTIPLE CONSTRUCTION A. BUILDING: 01 B. WING _____	(X3) DATE SURVEY COMPLETED R 06/19/2024
NAME OF PROVIDER OR SUPPLIER CURRITUCK HOUSE		STREET ADDRESS, CITY, STATE, ZIP CODE 141 MOYOCK LANDING DRIVE MOYOCK, NC 27958		
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETE DATE
{C 101}	Continued From page 1 nurses station serving the locked unit. An additional emergency release switch shall be provided for each locked door and located within 3 feet of the door. The switches should be accessible. Findings on June 19, 2024: a. The screamer boxes protecting the release switches had plastic ties securing the boxes. The ties were not easily breakable requiring excessive force or tools to remove. The ties were removed at the time of survey.	{C 101}		
{C 111}	Must Have Current San. & Fire Safety Reports SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0302 DESIGN AND CONSTRUCTION(f) The facility shall have current sanitation and fire and building safety inspection reports which shall be maintained in the home and available for review. This Rule is not met as evidenced by: 1. Review of records revealed that the facility did not have current fire and building safety inspection reports maintained in the home and available for review. Findings on June 19, 2024: a. The most current Fire Sprinkler System inspection report was dated October 3, 2022. Due to issues with the sprinkler system, they have not been able to conduct an inspection.	{C 111}		
{C 164}	Housekeeping and Furnishings-Clean, Repaired SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0306 HOUSEKEEPING AND	{C 164}		

Division of Health Service Regulation

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: HAL027003	(X2) MULTIPLE CONSTRUCTION A. BUILDING: 01 B. WING _____	(X3) DATE SURVEY COMPLETED R 06/19/2024
NAME OF PROVIDER OR SUPPLIER CURRITUCK HOUSE		STREET ADDRESS, CITY, STATE, ZIP CODE 141 MOYOCK LANDING DRIVE MOYOCK, NC 27958		
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETE DATE
{C 164}	Continued From page 2 FURNISHINGS (a) Adult care homes shall: (1) have walls, ceilings, and floors or floor coverings kept clean and in good repair; (2) have no chronic unpleasant odors; (3) have furniture clean and in good repair; (e) This Rule shall apply to new and existing facilities. This Rule is not met as evidenced by: 1. Observations revealed that the furniture was not kept in good repair. Findings on June 19, 2024: d. Room 603 - the drawers on the wardrobe unit were off of the track and the veneer was peeling off. Interview with staff revealed that they will be replacing the entire unit and, therefore, did not repair this unit as the room is currently empty.	{C 164}		
{C 189}	Building Equipment Maintained Safe, Operating SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0311 OTHER REQUIREMENTS (a) The building and all fire safety, electrical, mechanical, and plumbing equipment in an adult care home shall be maintained in a safe and operating condition. (k) This Rule shall apply to new and existing facilities with the exception of Paragraph (e) which shall not apply to existing facilities. This Rule is not met as evidenced by: 1. Based on observation the facility's fire safety equipment is not maintained in operating condition. Failure to maintain the sprinkler system	{C 189}		

Division of Health Service Regulation

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: HAL027003	(X2) MULTIPLE CONSTRUCTION A. BUILDING: 01 B. WING _____	(X3) DATE SURVEY COMPLETED R 06/19/2024
NAME OF PROVIDER OR SUPPLIER CURRITUCK HOUSE		STREET ADDRESS, CITY, STATE, ZIP CODE 141 MOYOCK LANDING DRIVE MOYOCK, NC 27958		
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETE DATE
{C 189}	Continued From page 3 equipment in operating condition could affect occupants of the facility if the equipment did not operate to suppress a fire. New Deficiency: Findings on June 19, 2024: a. The dry system has gone down since the previous survey. Parts were ordered and repairs should be completed by the end of the week. 2. Based on observation and testing there is failure to maintain the facility's emergency fire alarm system devices and equipment in a safe operating condition. All the occupants of the facility could be affected if the equipment failed to alert the occupants in case of a fire. Findings on June 19, 2024: c. The fire alarm panel has both the trouble signal lit and the supervisory signal lit. The panel states that there is an issue with the dry system tamper.	{C 189}		
{C 199}	Exhaust Ventilation SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0311 OTHER REQUIREMENTS (g) The spaces listed in this Paragraph shall be provided with exhaust ventilation at the rate of two cubic feet per minute per square foot. This requirement does not apply to facilities licensed before April 1, 1984, with natural ventilation in these specified spaces: (1) soiled linen storage; (2) soil utility room; (3) bathrooms and toilet rooms; (4) housekeeping closets; and	{C 199}		

Division of Health Service Regulation

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: HAL027003	(X2) MULTIPLE CONSTRUCTION A. BUILDING: 01 B. WING _____	(X3) DATE SURVEY COMPLETED R 06/19/2024
NAME OF PROVIDER OR SUPPLIER CURRITUCK HOUSE		STREET ADDRESS, CITY, STATE, ZIP CODE 141 MOYOCK LANDING DRIVE MOYOCK, NC 27958		
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETE DATE
{C 199}	Continued From page 4 (5) laundry area. (k) This Rule shall apply to new and existing facilities with the exception of Paragraph (e) which shall not apply to existing facilities. This Rule is not met as evidenced by: 1. Observations revealed that the facility did not maintain exhaust ventilation in specified spaces. Lack of ventilation allows for the build up humidity that can cause mildew and slick areas and prevents the dissipation of odors. Findings on June 19, 2024: a. Kitchen Housekeeping - the exhaust fan is not working. The parts have not been received to conduct the repairs. b. Room 603 Bath - the exhaust fan is not working. The parts have not been received to conduct the repairs. c. 600 Hall - there was a general pattern of exhaust fans not working on this hall. The parts have not been received to conduct the repairs.	{C 199}		