



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Brookdale Arbor Place	Provider Number	2278
Address	12806 Bothell-Everett HWY ,	Approval Status	Approved
City, State, Zip	Everett, WA 98208	Facility Type	Residential Care

On 06/02/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

All violations noted during previous related inspection(s) have been corrected.

Owner or Owner's Representative

Signature

Johnna Booth - MAINT Supervisor
Print Name and Title

Deputy State Fire Marshal Brandon G. Brown
16778 146 ST SE
Monroe WA 98272
(360) 791-7037

Signature

This document was prepared by Residential Care Services for the Locator website.

Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Brookdale Arbor Place	Provider Number	2278
Address	12806 Bothell-Everett HWY ,	Approval Status	Disapproved
City, State, Zip	Everett, WA 98208	Facility Type	Residential Care

On 04/02/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

1 Fueled Equipment General

Fueled equipment including, but not limited to, motorcycles, mopeds, lawn-care equipment, portable generators and portable cooking equipment, shall not be stored, operated or repaired within a building.

Exceptions:

1. Buildings or rooms constructed for such use in accordance with the International Building Code.
2. Where allowed by Section 314.
3. Storage of equipment utilized for maintenance purposes is allowed in approved locations when the aggregate fuel capacity of the stored equipment does not exceed 10 gallons (38 L) and the building is equipped throughout with an automatic sprinkler system installed in accordance with Section 903.3.1.1.

(IFC 313.1 2021)

There was a gas grill with propane tank stored in the main laundry room.

2 Listing

603.5.1 Listing. Relocatable power taps shall be listed in accordance with UL 1363. Current taps shall be listed and labeled in accordance with UL 498A.

(IFC 603.5.1, 2021)

1. There was 3 multi-plug adapters that does not have over current protection in use in room 306.

2. There was multi-plug adapter that does not have over current protection in room 111.

3. There was multi-plug adapter that does not have over current protection in room 112.

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Brookdale Arbor Place	Provider Number	2278
Address	12806 Bothell-Everett HWY ,	Approval Status	Disapproved
City, State, Zip	Everett, WA 98208	Facility Type	Residential Care

On 04/02/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

3 Application and Use

603.5.2 Application and use. Relocatable power taps and current taps shall be directly connected to a permanently installed receptacle. Exceptions: 1. Where approved for use in a Group A occupancy or in a meeting room in a Group B occupancy, not more than five relocatable power taps shall be permitted to be connected together or connected to an extension cord for temporary use to supply power to electronic equipment. 2. Current taps and relocatable power taps shall not be required to connect directly to a permanently installed receptacle outlet where used for 90 days or less for the purpose of testing the performance of such devices. (IFC 603.5.2, 2021)	There is a power strip plugged into a non-compliant multi-plug adapter in the maintenance office.
---	---

4 Extension Cords

Extension cords. Extension cords shall not be a substitute for permanent wiring and shall be listed and labeled in accordance with UL 817. Extension cords shall not be affixed to structures, extended through walls, ceilings or floors, or under doors or floor coverings, nor shall such cords be subject to environmental damage or physical impact. Extension cords shall be used only with portable appliances. Extension cords marked for indoor use shall not be used outdoors.. (IFC 603.6 2021)	1. There was an extension cord utilized as permanent wiring in room 306 2. There was an extension cord utilized as permanent wiring in the business office managers office.
---	--

5 Cleaning

Hoods, grease-removal devices, fans, ducts and other appurtenances shall be cleaned at intervals as required by Sections 606.3.3.1 through 606.3.3.3. (IFC 606.3.3 2021)	Facility is unable to provide documentation for the semi-annual hood cleaning.
---	--



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Brookdale Arbor Place	Provider Number	2278
Address	12806 Bothell-Everett HWY ,	Approval Status	Disapproved
City, State, Zip	Everett, WA 98208	Facility Type	Residential Care

On 04/02/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

6 Appliance Connection to Building Piping

Gas-fired commercial cooking appliances installed on casters and appliances that are moved for cleaning and sanitation purposes shall be connected to the piping system with an appliance connector listed as complying with ANSI Z21.69/CSA 6.16. The commercial cooking appliance connector installation shall be configured in accordance with the manufacturer's installation instructions. Movement of appliances with casters shall be limited by a restraining device installed in accordance with the connector and appliance manufacturer's instructions. (IFC 606.4 2021)	The gas appliances on casters in the kitchen are not limited by a restraining device.
--	---

7 Smoke Barriers

The fire-resistance rating and smoke-resistant characteristics of smoke barriers shall be maintained. (IFC 701.3 2021)	1. There was an unsealed penetration in corridor near 211. 2. There was several unsealed penetrations in the kitchen ceiling.
---	--

8 Owner's Responsibility

The owner shall maintain an inventory of all required fire-resistance-rated construction, construction installed to resist the passage of smoke and the construction included in Sections 703 through 707 and Sections 602.4.1 and 602.4.2 of the International Building Code. Such construction shall be visually inspected by the owner annually and properly repaired, restored or replaced where damaged, altered, breached or penetrated. Records of inspections and repairs shall be maintained. Where concealed, such elements shall not be required to be visually inspected by the owner unless the concealed space is accessible by the removal or movement of a panel, access door, ceiling tile or similar movable entry to the space. (IFC 701.6 2021)	Facility is unable to provide documentation that the annual fire resistance rated construction material inspection has been completed.
--	--

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Brookdale Arbor Place	Provider Number	2278
Address	12806 Bothell-Everett HWY ,	Approval Status	Disapproved
City, State, Zip	Everett, WA 98208	Facility Type	Residential Care

On 04/02/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

9 Inspection and Maintenance

Opening protectives in fire-resistance-rated assemblies shall be inspected and maintained in accordance with NFPA 80. Opening protectives in smoke barriers shall be inspected and maintained in accordance with NFPA 80 and NFPA 105. Openings in smoke partitions shall be inspected and maintained in accordance with NFPA 105. Fire doors and smoke and draft control doors shall not be blocked, obstructed, or otherwise made inoperable. Fusible links shall be replaced promptly whenever fused or damaged. Opening protectives and smoke and draft control doors shall not be modified. (IFC 705.2 2021)	1. Resident room 318 fire door had a deadbolt lock removed, leaving a hole in the door. 2. Resident room 324 doors is equipped with an unauthorized magnet hold open devices that is not connected to the fire alarm system, preventing it from automatically closing and latching. 3. Resident room 329 doors is equipped with an unauthorized magnet hold open devices that is not connected to the fire alarm system, preventing it from automatically closing and latching.
--	---

10 Door Operation

Swinging fire doors shall close from the full-open position and latch automatically. (IFC 705.2.4 2021)	1. The fire rated cross corridor door near room 338 would not close and latch from the fully open position. 2. Resident room 328 fire door would not close and latch from the fully open position. 3. Resident room 205 fire door would not close and latch from the fully open position. 4. The fire rated cross corridor door across from the 1st floor mechanical room would not close and latch from the fully open position.
--	---

11 Duct and Air Transfer Openings - Maintaining Protection

Dampers protecting ducts and air transfer openings shall be inspected and maintained in accordance with NFPA 80 and NFPA 105. Other products or materials used to protect the openings for ducts and air transfer openings shall be securely attached to or bonded to the construction containing the duct or air transfer opening, without visible openings through or into the cavity of the construction. Any damaged products or materials protecting duct and air transfer openings shall be repaired, restored or replaced. (IFC 706.1 2018)	Facility is unable to provide documentation for the 4 year fire and smoke damper inspection.
---	--



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Brookdale Arbor Place	Provider Number	2278
Address	12806 Bothell-Everett HWY ,	Approval Status	Disapproved
City, State, Zip	Everett, WA 98208	Facility Type	Residential Care

On 04/02/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

12 Obstructed Locations

Automatic sprinklers shall be installed with regard to obstructions that will delay activation or obstruct the water distribution pattern and shall be in accordance with the applicable automatic sprinkler system standard that is being used. Automatic sprinklers shall be installed in or under covered kiosks, displays, booths, concession stands or equipment that exceeds 4 feet (1219 mm) in width. Not less than a 3-foot (914 mm) clearance shall be maintained between automatic sprinklers and the top of piles of combustible fibers. Exception: Kitchen equipment under exhaust hoods protected with a fire-extinguishing system in accordance with Section 904. (IFC 903.3.3 2021)	The sprinkler head in the walk-in freezer had boxes and food obstructing the flow pattern of the sprinkler.
--	--

13 Testing and Maintenance

Sprinkler systems shall be tested and maintained in accordance with Section 901. (IFC 903.5 2021)	1. As per documents provided the annual sprinkler inspection conducted on 8/24/2024 had deficiencies noted that have not been corrected. 2. Mixed standard response and quick response sprinkler heads were found in 3rd floor stairwell 3. 3. The hydraulic calculation placard is missing from the sprinkler system.
---	---

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Brookdale Arbor Place	Provider Number	2278
Address	12806 Bothell-Everett HWY ,	Approval Status	Disapproved
City, State, Zip	Everett, WA 98208	Facility Type	Residential Care

On 04/02/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

14 Portable Fire Extinguishers - General Requirements

Portable fire extinguishers shall be selected, installed and maintained in accordance with this section and NFPA 10. Exceptions: 1. The distance of travel to reach an extinguisher shall not apply. The travel distance to reach an extinguisher shall not apply to the spectator seating portions of Group A-5 occupancies. 2. Thirty-day inspections shall not be required and maintenance shall be allowed to be once every three years for dry-chemical or halogenated agent portable fire extinguishers that are supervised by a listed and approved electronic monitoring device, provided that all of the following conditions are met: 2.1. Electronic monitoring shall confirm that extinguishers are properly positioned, properly charged and unobstructed. 2.2. Loss of power or circuit continuity to the electronic monitoring device shall initiate a trouble signal. 2.3. The extinguishers shall be installed inside of a building or cabinet in a noncorrosive environment. 2.4. Electronic monitoring devices and supervisory circuits shall be tested every 3 years when extinguisher maintenance is performed. 2.5. A written log of required hydrostatic test dates for extinguishers shall be maintained by the owner to verify that hydrostatic tests are conducted at the frequency required by NFPA 10. 3. In Group I-3, portable fire extinguishers shall be permitted to be located at staff locations. (IFC 906.2 2021)	Facility was unable to provide the required documentation for monthly fire extinguisher maintenance in accordance with NFPA 10.
---	--

15 Inspection, Testing and Maintenance

The maintenance and testing schedules and procedures for fire alarm and fire detection systems shall be in accordance with Sections 907.8.1 through 907.8.5 and NFPA 72. Records of inspection, testing and maintenance shall be maintained. (IFC 907.8 2021)	Facility is unable to provide documentation for the monthly single station smoke alarm testing.
---	--

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Brookdale Arbor Place	Provider Number	2278
Address	12806 Bothell-Everett HWY ,	Approval Status	Disapproved
City, State, Zip	Everett, WA 98208	Facility Type	Residential Care

On 04/02/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

16 Means of Egress Continuity

The path of egress travel along a means of egress shall not be interrupted by any building element other than a means of egress component as specified in this chapter. Obstructions shall not be placed in the minimum width or required capacity of a means of egress component except projections permitted by this chapter. The minimum width or required capacity of a means of egress system shall not be diminished along the path of egress travel. (IFC 1003.6 2021)	There was a multiple floor mat and trash blocking the emergency exit in the kitchen.
--	--

 
17 Emergency Power for Illumination - General

In the event of power supply failure in rooms and spaces that require two or more exits or access to exits, an emergency electrical system shall automatically illuminate all of the following areas: 1. Aisles 2. Corridors 3. Exit access stairways and ramps (IFC 1008.3.1 2021)	1. The emergency egress light in the 2nd floor stairwell 2 would not illuminate when the test button was pressed. 2. There is emergency lighting in the first floor stairwells to illuminate the exit access in stairwell 1, 2, 3, and 4.
---	--

Next inspection scheduled on or after: 05/02/2025

Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.

Owner or Authorized Representative


Signature

Angela Kinsel Executive Director
Print Name and Title

Deputy State Fire Marshal Brandon G. Brown
16778 146 ST SE
Monroe WA 98272
(360) 791-7037


Signature