



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Aegis of Issaquah
Address 780 NW JUNIPER ST ,
City, State, Zip Issaquah, WA

Provider Number 1997
Approval Status Approved
Facility Type Residential Care

On 06/30/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

All violations noted during previous related inspection(s) have been corrected.

Owner or Owner's Representative

Signature

Print Name and Title

Jin Gas

Deputy State Fire Marshal Jason Van Gorkum
2803 156 AVE SE
Bellevue WA 98007
(509) 406-7209

Signature

This document was prepared by Residential Care Services for the Locator website.

Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Aegis of Issaquah	Provider Number	1997
Address	780 NW JUNIPER ST ,	Approval Status	Disapproved
City, State, Zip	Issaquah, WA 98027	Facility Type	Residential Care

On 02/26/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

1 Record Keeping

Records shall be maintained of required emergency evacuation drills and include the following information:

1. Identity of the person conducting the drill.
2. Date and time of the drill.
3. Notification method used.
4. Employees on duty and participating.
5. Number of occupants evacuated.
6. Special conditions simulated.
7. Problems encountered.
8. Weather conditions when occupants were evacuated.
9. Time required to accomplish complete evacuation.

(IFC 0405.6 2021)

Drills shall be held at unexpected times and under varying conditions to simulate the unusual conditions that occur in case of fire.

Exceptions:

1. In severe climates, the fire code official shall have the authority to modify the emergency evacuation drill termination points and frequency.
2. In Groups I-1, I-2, I-3 and R-4, where staff-only emergency evacuation drills are conducted after visiting hours or where care recipients are expected to be asleep, a coded announcement shall be an acceptable alternative to audible alarms.

(IFC 405.2 2021)

Where a fire alarm system is provided, emergency evacuation drills shall be initiated by activating the fire alarm system.

(IFC 405.8, 2021)

Corrected

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Aegis of Issaquah
Address 780 NW JUNIPER ST ,
City, State, Zip Issaquah, WA 98027

Provider Number 1997
Approval Status Disapproved
Facility Type Residential Care

On 02/26/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

2 Cleaning

Hoods, grease-removal devices, fans, ducts and other appurtenances shall be cleaned at intervals as required by Sections 606.3.3.1 through 606.3.3.3.

(IFC 606.3.3 2021)

The following deficiencies were cited as a result of this inspection:

At the time of inspection, the following paperwork was not provided:

1. First semi-annual hood cleaning
2. Second semi-annual hood cleaning

All inspection reports must verify that the system has no deficiencies, or document that all deficiencies have been corrected.

3 Owner's Responsibility

The owner shall maintain an inventory of all required fire-resistance-rated construction, construction installed to resist the passage of smoke and the construction included in Sections 703 through 707 and Sections 602.4.1 and 602.4.2 of the International Building Code. Such construction shall be visually inspected by the owner annually and properly repaired, restored or replaced where damaged, altered, breached or penetrated. Records of inspections and repairs shall be maintained. Where concealed, such elements shall not be required to be visually inspected by the owner unless the concealed space is accessible by the removal or movement of a panel, access door, ceiling tile or similar movable entry to the space.

(IFC 701.6 2021)

Corrected

4 Testing and Maintenance

Sprinkler systems shall be tested and maintained in accordance with Section 901.

(IFC 903.5 2021)

The following deficiencies were cited as a result of this inspection:

At the time of inspection, the following paperwork was not provided:

1. Annual forward flow test (NFPA 25 13.7.2)

All inspection reports must verify that the system has no deficiencies, or document that all deficiencies have been corrected.

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Aegis of Issaquah
Address 780 NW JUNIPER ST ,
City, State, Zip Issaquah, WA 98027

Provider Number 1997
Approval Status Disapproved
Facility Type Residential Care

On 02/26/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

5 Extinguishing System Service

Automatic fire-extinguishing systems shall be serviced not less frequently than every six months and after activation of the system. Inspection shall be by qualified individuals, and a certificate of inspection shall be forwarded to the fire code official upon completion.

(IFC 904.13.5.2 2021)

The following deficiencies were cited as a result of this inspection:

At the time of inspection, the following paperwork was not provided:

1. First semi-annual servicing
2. Second semi-annual service

All inspection reports must verify that the system has no deficiencies, or document that all deficiencies have been corrected.

At time of inspection the following was observed:

1. All the nozzles are missing there protective covers
2. Nozzle over deep fryer needs to be adjusted.

6 Inspection, Testing and Maintenance

The maintenance and testing schedules and procedures for fire alarm and fire detection systems shall be in accordance with Sections 907.8.1 through 907.8.5 and NFPA 72. Records of inspection, testing and maintenance shall be maintained.

(IFC 907.8 2021)

At time of inspection the following was observed:

1. Vendor sticker found on panel was in a Yellow status.

7 Carbon Monoxide Detection - General

Carbon monoxide detection shall be installed in new buildings in accordance with Sections 915.1.1 through 915.6. Carbon monoxide detection shall be installed in existing buildings in accordance with Chapter 11 of the International Fire Code.

(IFC 0915.1 2021 WAC 51-54A)

Corrected

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Aegis of Issaquah
Address 780 NW JUNIPER ST ,
City, State, Zip Issaquah, WA 98027

Provider Number 1997
Approval Status Disapproved
Facility Type Residential Care

On 02/26/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

8 Activation Test

Emergency lighting equipment shall be tested monthly for a duration of not less than 30 seconds. The test shall be performed manually or by an automated self-testing and self-diagnostic routine. Where testing is performed by self-testing and self-diagnostics, a visual inspection of the emergency lighting equipment shall be conducted monthly to identify any equipment displaying a trouble indicator or that has become damaged or otherwise impaired.

(IFC 1032.10.1 2021)

Corrected

9 Power Test

Battery-powered emergency lighting equipment shall be tested annually by operating the equipment on battery power for not less than 90 minutes.

(IFC 1031.10.2 2021)

Corrected

10 Maintenance

Emergency and standby power systems shall be maintained in accordance with NFPA 110 and NFPA 111 such that the system is capable of supplying service within the time specified for the type and duration required.

(IFC 1203.4 2021)

The following deficiencies were cited as a result of this inspection:

At the time of inspection, the following paperwork was not provided:

1. Annual service report
Corrected
2. Log of weekly inspections
Corrected
3. Monthly 30-minute full load test
4. Diesel fuel testing

All inspection reports must verify that the system has no deficiencies, or document that all deficiencies have been corrected.

11 Security

Compressed gas containers, cylinders, tanks and systems shall be secured against accidental dislodgement and against access by unauthorized personnel in accordance with Sections 5303.5.1 through 5303.5.3.

(IFC 5303.5 2021)

Corrected

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Aegis of Issaquah
Address 780 NW JUNIPER ST ,
City, State, Zip Issaquah, WA 98027

Provider Number 1997
Approval Status Disapproved
Facility Type Residential Care

On 02/26/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

12 NFPA 80 Fire Door Inspection and Testing

5.2.1 Inspection and Testing. Upon completion of the installation, door, shutters, and window assemblies shall be inspected and tested in accordance with 5.2.4.

5.2.4 Periodic Inspection and Testing.

5.2.4.1 Periodic inspections and testing shall be performed not less than annually.

5.2.2.4 A record of all inspections and testing shall be provided that includes, but is not limited to, the following information:

1. Date of inspection
2. Name of facility
3. Address of facility
4. Name of person(s) performing inspections and testing
5. Company name and address of inspecting company
6. Signature of inspector of record
7. Individual record of each inspected and tested fire door assembly
8. Opening identifier and location of each inspected and tested fire door assembly
9. Type and description of each inspected and tested fire door assembly
10. Verification of visual inspection and functional operation
11. Listing of deficiencies in accordance with 5.2.3, Section 5.3, and Section 5.4

And the following shall be checked:

1. Labels are clearly visible and legible
2. No open holes or breaks exist in surfaces of wither the door or frame
3. Glazing, vision light frames, and glazing beads are intact and securely fastened in place, if so equipped.
4. The door, frame, hinges, hardware, and non combustible threshold are secured, aligned and in working order with no visible, signs of damage
5. No parts are missing or broken
6. Door clearances do not exceed clearances listed in 4.8.4 and 6.3.1.7
7. The self-closing device is operational,; that is, the active door completely closes when operated from the full open position
8. If a coordinator is installed, the inactive lead close before the active lead

Corrected

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Aegis of Issaquah	Provider Number	1997
Address	780 NW JUNIPER ST ,	Approval Status	Disapproved
City, State, Zip	Issaquah, WA 98027	Facility Type	Residential Care

On 02/26/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
9. Latching hardware operates and secures the door when it is in the closed position 10. Auxiliary hardware items that interfere or prohibit operation are not installed on the door or frame 11. No field modification to the door assembly have been performed that void the label. 12. Meeting edge protection, gasketing and edge seals where required, are inspected to verify their presence and integrity 13. Signage affixed to a door meets the requirements listed in 4.1.4	

Next inspection scheduled on or after: 03/28/2025

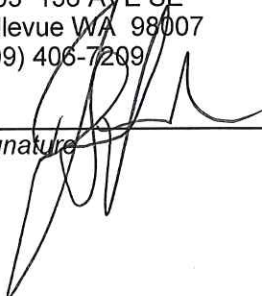
Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.

Owner or Authorized Representative


Signature

Jim Gao Maintenance
Print Name and Title

Deputy State Fire Marshal Jason Van Gorkum
2803 156 AVE SE
Bellevue WA 98007
(509) 406-7209


Signature

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Aegis of Issaquah	Provider Number	1997
Address	780 NW JUNIPER ST ,	Approval Status	Disapproved
City, State, Zip	Issaquah, WA 98027	Facility Type	Residential Care

On 12/18/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

1 Record Keeping

Records shall be maintained of required emergency evacuation drills and include the following information: 1. Identity of the person conducting the drill. 2. Date and time of the drill. 3. Notification method used. 4. Employees on duty and participating. 5. Number of occupants evacuated. 6. Special conditions simulated. 7. Problems encountered. 8. Weather conditions when occupants were evacuated. 9. Time required to accomplish complete evacuation. (IFC 0405.6 2021) Drills shall be held at unexpected times and under varying conditions to simulate the unusual conditions that occur in case of fire. Exceptions: 1. In severe climates, the fire code official shall have the authority to modify the emergency evacuation drill termination points and frequency. 2. In Groups I-1, I-2, I-3 and R-4, where staff-only emergency evacuation drills are conducted after visiting hours or where care recipients are expected to be asleep, a coded announcement shall be an acceptable alternative to audible alarms. (IFC 405.2 2021) Where a fire alarm system is provided, emergency evacuation drills shall be initiated by activating the fire alarm system. (IFC 405.8, 2021)	The following deficiencies were cited as a result of this inspection: At the time of inspection, the following paperwork was not provided: 1. Facility cannot provide documentation for the completion of twelve planned and unannounced fire drills in the previous 12 months. All inspection reports must verify that the system has no deficiencies, or document that all deficiencies have been corrected.
--	---

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Aegis of Issaquah	Provider Number	1997
Address	780 NW JUNIPER ST ,	Approval Status	Disapproved
City, State, Zip	Issaquah, WA 98027	Facility Type	Residential Care

On 12/18/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

2 Cleaning

Hoods, grease-removal devices, fans, ducts and other appurtenances shall be cleaned at intervals as required by Sections 606.3.3.1 through 606.3.3.3.

(IFC 606.3.3 2021)

The following deficiencies were cited as a result of this inspection:

At the time of inspection, the following paperwork was not provided:

1. First semi-annual hood cleaning
2. Second semi-annual hood cleaning

All inspection reports must verify that the system has no deficiencies, or document that all deficiencies have been corrected.

3 Owner's Responsibility

The owner shall maintain an inventory of all required fire-resistance-rated construction, construction installed to resist the passage of smoke and the construction included in Sections 703 through 707 and Sections 602.4.1 and 602.4.2 of the International Building Code. Such construction shall be visually inspected by the owner annually and properly repaired, restored or replaced where damaged, altered, breached or penetrated. Records of inspections and repairs shall be maintained. Where concealed, such elements shall not be required to be visually inspected by the owner unless the concealed space is accessible by the removal or movement of a panel, access door, ceiling tile or similar movable entry to the space.

(IFC 701.6 2021)

The following deficiencies were cited as a result of this inspection:

At the time of inspection, the following paperwork was not provided:

1. Facility will need to identify and establish a schedule for inspection of Fire-Rated construction. Annual inspection of fire-resistance-rated construction will need to be performed and completed.

All inspection reports must verify that the system has no deficiencies, or document that all deficiencies have been corrected.

4 Testing and Maintenance

Sprinkler systems shall be tested and maintained in accordance with Section 901.

(IFC 903.5 2021)

The following deficiencies were cited as a result of this inspection:

At the time of inspection, the following paperwork was not provided:

1. Annual forward flow test (NFPA 25 13.7.2)

All inspection reports must verify that the system has no deficiencies, or document that all deficiencies have been corrected.

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Aegis of Issaquah	Provider Number	1997
Address	780 NW JUNIPER ST ,	Approval Status	Disapproved
City, State, Zip	Issaquah, WA 98027	Facility Type	Residential Care

On 12/18/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

5 Extinguishing System Service

Automatic fire-extinguishing systems shall be serviced not less frequently than every six months and after activation of the system. Inspection shall be by qualified individuals, and a certificate of inspection shall be forwarded to the fire code official upon completion.

(IFC 904.13.5.2 2021)

The following deficiencies were cited as a result of this inspection:

At the time of inspection, the following paperwork was not provided:

1. First semi-annual servicing
2. Second semi-annual service

All inspection reports must verify that the system has no deficiencies, or document that all deficiencies have been corrected.

At time of inspection the following was observed:

1. All the nozzles are missing there protective covers
2. Nozzle over deep fryer needs to be adjusted.

6 Inspection, Testing and Maintenance

The maintenance and testing schedules and procedures for fire alarm and fire detection systems shall be in accordance with Sections 907.8.1 through 907.8.5 and NFPA 72. Records of inspection, testing and maintenance shall be maintained.

(IFC 907.8 2021)

At time of inspection the following was observed:

1. Vendor sticker found on panel was in a Yellow status.

March 3

7 Carbon Monoxide Detection - General

Carbon monoxide detection shall be installed in new buildings in accordance with Sections 915.1.1 through 915.6. Carbon monoxide detection shall be installed in existing buildings in accordance with Chapter 11 of the International Fire Code.

(IFC 0915.1 2021 WAC 51-54A)

The following deficiencies were cited as a result of this inspection:

At the time of inspection, the following paperwork was not provided:

1. Carbon Monoxide Alarms and Detectors will need to be tested, maintained and documented on am monthly schedule

All inspection reports must verify that the system has no deficiencies, or document that all deficiencies have been corrected.

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Aegis of Issaquah
Address 780 NW JUNIPER ST ,
City, State, Zip Issaquah, WA 98027

Provider Number 1997
Approval Status Disapproved
Facility Type Residential Care

On 12/18/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

8 Activation Test

Emergency lighting equipment shall be tested monthly for a duration of not less than 30 seconds. The test shall be performed manually or by an automated self-testing and self-diagnostic routine. Where testing is performed by self-testing and self-diagnostics, a visual inspection of the emergency lighting equipment shall be conducted monthly to identify any equipment displaying a trouble indicator or that has become damaged or otherwise impaired.

(IFC 1032.10.1 2021)

The following deficiencies were cited as a result of this inspection:

At the time of inspection, the following paperwork was not provided:

1. Monthly 30-second activation testing had not been performed and documented

All inspection reports must verify that the system has no deficiencies, or document that all deficiencies have been corrected.

9 Power Test

Battery-powered emergency lighting equipment shall be tested annually by operating the equipment on battery power for not less than 90 minutes.

(IFC 1031.10.2 2021)

The following deficiencies were cited as a result of this inspection:

At the time of inspection, the following paperwork was not provided:

1. Annual 90 minute power test had not been performed and documented

All inspection reports must verify that the system has no deficiencies, or document that all deficiencies have been corrected.

10 Maintenance

Emergency and standby power systems shall be maintained in accordance with NFPA 110 and NFPA 111 such that the system is capable of supplying service within the time specified for the type and duration required.

(IFC 1203.4 2021)

The following deficiencies were cited as a result of this inspection:

At the time of inspection, the following paperwork was not provided:

1. Annual service report
2. Log of weekly inspections ✓
3. Monthly 30-minute full load test ✓
4. Diesel fuel testing

All inspection reports must verify that the system has no deficiencies, or document that all deficiencies have been corrected.

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Aegis of Issaquah	Provider Number	1997
Address	780 NW JUNIPER ST ,	Approval Status	Disapproved
City, State, Zip	Issaquah, WA 98027	Facility Type	Residential Care

On 12/18/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

11 Security

Compressed gas containers, cylinders, tanks and systems shall be secured against accidental dislodgement and against access by unauthorized personnel in accordance with Sections 5303.5.1 through 5303.5.3.

(IFC 5303.5 2021)

At time of inspection the following was observed:

1. Two loose tanks found in kitchen. ✓

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Aegis of Issaquah	Provider Number	1997
Address	780 NW JUNIPER ST ,	Approval Status	Disapproved
City, State, Zip	Issaquah, WA 98027	Facility Type	Residential Care

On 12/18/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

12 NFPA 80 Fire Door Inspection and Testing

5.2.1 Inspection and Testing. Upon completion of the installation, door, shutters, and window assemblies shall be inspected and tested in accordance with 5.2.4.

5.2.4 Periodic Inspection and Testing.

5.2.4.1 Periodic inspections and testing shall be performed not less than annually.

5.2.2.4 A record of all inspections and testing shall be provided that includes, but is not limited to, the following information:

1. Date of inspection
2. Name of facility
3. Address of facility
4. Name of person(s) performing inspections and testing
5. Company name and address of inspecting company
6. Signature of inspector of record
7. Individual record of each inspected and tested fire door assembly
8. Opening identifier and location of each inspected and tested fire door assembly
9. Type and description of each inspected and tested fire door assembly
10. Verification of visual inspection and functional operation
11. Listing of deficiencies in accordance with 5.2.3, Section 5.3, and Section 5.4

And the following shall be checked:

1. Labels are clearly visible and legible
2. No open holes or breaks exist in surfaces of either the door or frame
3. Glazing, vision light frames, and glazing beads are intact and securely fastened in place, if so equipped.
4. The door, frame, hinges, hardware, and non-combustible threshold are secured, aligned and in working order with no visible signs of damage
5. No parts are missing or broken
6. Door clearances do not exceed clearances listed in 4.8.4 and 6.3.1.7
7. The self-closing device is operational; that is, the active door completely closes when operated from the full open position
8. If a coordinator is installed, the inactive lead closes before the active lead

The following deficiencies were cited as a result of this inspection:

At the time of inspection, the following paperwork was not provided:

1. Facility will need to identify and establish a schedule for inspection of Fire Doors. Annual inspection of fire doors will need to be performed and completed.

All inspection reports must verify that the system has no deficiencies, or document that all deficiencies have been corrected.

At time of inspection the following was observed:

1. Resident door 310 would not close and latch
2. Resident room 312 would not close and latch

This document was prepared by Residential Care Services for the Locator website.



Business Name	Aegis of Issaquah	Provider Number	1997
Address	780 NW JUNIPER ST ,	Approval Status	Disapproved
City, State, Zip	Issaquah, WA 98027	Facility Type	Residential Care

On 12/18/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
9. Latching hardware operates and secures the door when it is in the closed position 10. Auxiliary hardware items that interfere or prohibit operation are not installed on the door or frame 11. No field modification to the door assembly have been performed that void the label. 12. Meeting edge protection, gasketing and edge seals where required, are inspected to verify their presence and integrity 13. Signage affixed to a door meets the requirements listed in 4.1.4	

Next inspection scheduled on or after: 01/17/2025

Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.

Owner or Authorized Representative

Signature

Print Name and Title

Jim Gao, Maintenance Director

Deputy State Fire Marshal Jason Van Gorkum
2803 156 AVE SE
Bellevue WA 98007
(509) 406-7209

Signature

This document was prepared by Residential Care Services for the Locator website.