



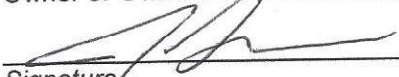
Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Brookdale Canyon Lakes	Provider Number	2263
Address	2802 W 35TH AVE ,	Approval Status	Approved
City, State, Zip	Kennewick, WA 99337	Facility Type	Residential Care

On 2/17/2026 the Office of the State Fire Marshal conducted an inspection at your facility.

All violations noted during previous related inspection(s) have been corrected.

Owner or Owner's Representative


Signature

Joseph Green, Executive Director II
Print Name and Title

Deputy State Fire Marshal Alan Harlan
2803 156TH AVE SE
Bellevue WA 98007
(425) 495-7121


Signature

Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Brookdale Canyon Lakes	Provider Number	2263
Address	2802 W 35TH AVE ,	Approval Status	Disapproved
City, State, Zip	Kennewick, WA 99337	Facility Type	Residential Care

On 2/11/2026 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

1 Admin - (ITM) Inspection, Testing, & Maintenance

Any citation that requires inspection, testing, or maintenance (ITM) is required to have the testing completed, paper results delivered, and any deficiencies found during the ITM corrected before the citation is cleared."	
---	--

2 Ceiling Clearance

Storage shall be maintained 2 feet (610 mm) or more below the ceiling in nonsprinklered areas of buildings or not less than 18 inches (457 mm) below sprinkler head deflectors in sprinklered areas of buildings. Exceptions: 1. The 2-foot (610 mm) ceiling clearance is not required for storage along walls in nonsprinklered areas of buildings. 2. The 18-inch (457 mm) ceiling clearance is not required for storage along walls in areas of buildings equipped with an automatic sprinkler system in accordance with Section 903.3.1.1, 903.3.1.2 or 903.3.1.3. (IFC 315.2.1 2021)	Corrected
---	-----------

3 Abatement of Electrical Hazards

Abatement of unsafe conditions and electrical hazards. Conditions that constitute an electrical shock or fire hazard shall be abated.. (IFC 603.2 2021)	Corrected
--	-----------

4 Open electrical terminations

Open junction boxes and open-wiring splices shall be prohibited. Approved covers shall be provided for all switch and electrical outlet boxes. (IFC 603.2.2, 2021)	Corrected
---	-----------

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Brookdale Canyon Lakes
Address 2802 W 35TH AVE ,
City, State, Zip Kennewick, WA 99337

Provider Number 2263
Approval Status Disapproved
Facility Type Residential Care

On 2/11/2026 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

7 Extension Cords

Extension cords. Extension cords shall not be a substitute for permanent wiring and shall be listed and labeled in accordance with UL 817. Extension cords shall not be affixed to structures, extended through walls, ceilings or floors, or under doors or floor coverings, nor shall such cords be subject to environmental damage or physical impact. Extension cords shall be used only with portable appliances. Extension cords marked for indoor use shall not be used outdoors..

(IFC 603.6 2021)

Corrected

8 Maintaining Protection

Materials, systems and devices used to repair or protect breaches and openings in fire-resistance-rated construction and construction installed to resist the passage of smoke shall be maintained in accordance with Sections 703 through 707.

(IFC 701.5 2021)

Corrected

9 Owner's Responsibility

The owner shall maintain an inventory of all required fire-resistance-rated construction, construction installed to resist the passage of smoke and the construction included in Sections 703 through 707 and Sections 602.4.1 and 602.4.2 of the International Building Code. Such construction shall be visually inspected by the owner annually and properly repaired, restored or replaced where damaged, altered, breached or penetrated. Records of inspections and repairs shall be maintained. Where concealed, such elements shall not be required to be visually inspected by the owner unless the concealed space is accessible by the removal or movement of a panel, access door, ceiling tile or similar movable entry to the space.

(IFC 701.6 2021)

Corrected

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Brookdale Canyon Lakes	Provider Number	2263
Address	2802 W 35TH AVE ,	Approval Status	Disapproved
City, State, Zip	Kennewick, WA 99337	Facility Type	Residential Care

On 2/11/2026 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

10 Penetrations - Maintaining Protection

Materials and firestop systems used to protect membrane and through penetrations in fire-resistance-rated construction and construction installed to resist the passage of smoke shall be maintained. The materials and firestop systems shall be securely attached to or bonded to the construction being penetrated with no openings visible through or into the cavity of the construction. Where the system design number is known, the system shall be inspected to the listing criteria and manufacturer's installation instructions. (IFC 703.1 2021)	Corrected
---	-----------

11 Inspection and Maintenance

Opening protectives in fire-resistance-rated assemblies shall be inspected and maintained in accordance with NFPA 80. Opening protectives in smoke barriers shall be inspected and maintained in accordance with NFPA 80 and NFPA 105. Openings in smoke partitions shall be inspected and maintained in accordance with NFPA 105. Fire doors and smoke and draft control doors shall not be blocked, obstructed, or otherwise made inoperable. Fusible links shall be replaced promptly whenever fused or damaged. Opening protectives and smoke and draft control doors shall not be modified. (IFC 705.2 2021)	The following violation was observed: 1) The double fire doors near maintenance office were missing hardware on crash bar. 2) Room 129 propped open w / door wedge.
--	---

12 Door Operation

Swinging fire doors shall close from the full-open position and latch automatically. (IFC 705.2.4 2021)	The following violation was observed: The double fire door near room 15 would not latch from a fully opened position
--	---

13 Testing and Maintenance

Sprinkler systems shall be tested and maintained in accordance with Section 901. (IFC 903.5 2021)	The following violation was observed: 1) Room # 135 had painted sprinkler heads.
--	---

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Brookdale Canyon Lakes	Provider Number	2263
Address	2802 W 35TH AVE ,	Approval Status	Disapproved
City, State, Zip	Kennewick, WA 99337	Facility Type	Residential Care

On 2/11/2026 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

14 Extinguishing System Service

Automatic fire-extinguishing systems shall be serviced not less frequently than every six months and after activation of the system. Inspection shall be by qualified individuals, and a certificate of inspection shall be forwarded to the fire code official upon completion. (IFC 904.13.5.2 2021)	Corrected
---	-----------

15 Portable Fire Extinguishers - General Requirements

Portable fire extinguishers shall be selected, installed and maintained in accordance with this section and NFPA 10. Exceptions: 1. The distance of travel to reach an extinguisher shall not apply. The travel distance to reach an extinguisher shall not apply to the spectator seating portions of Group A-5 occupancies. 2. Thirty-day inspections shall not be required and maintenance shall be allowed to be once every three years for dry-chemical or halogenated agent portable fire extinguishers that are supervised by a listed and approved electronic monitoring device, provided that all of the following conditions are met: 2.1. Electronic monitoring shall confirm that extinguishers are properly positioned, properly charged and unobstructed. 2.2. Loss of power or circuit continuity to the electronic monitoring device shall initiate a trouble signal. 2.3. The extinguishers shall be installed inside of a building or cabinet in a noncorrosive environment. 2.4. Electronic monitoring devices and supervisory circuits shall be tested every 3 years when extinguisher maintenance is performed. 2.5. A written log of required hydrostatic test dates for extinguishers shall be maintained by the owner to verify that hydrostatic tests are conducted at the frequency required by NFPA 10. 3. In Group I-3, portable fire extinguishers shall be permitted to be located at staff locations. (IFC 906.2 2021)	Corrected
---	-----------

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Brookdale Canyon Lakes	Provider Number	2263
Address	2802 W 35TH AVE ,	Approval Status	Disapproved
City, State, Zip	Kennewick, WA 99337	Facility Type	Residential Care

On 2/11/2026 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

16 Unobstructed and Unobscured

Portable fire extinguishers shall not be obstructed or obscured from view. In rooms or areas in which visual obstruction cannot be completely avoided, means shall be provided to indicate the locations of extinguishers. (IFC 906.6 2021)	Corrected
--	-----------

17 Hangers and Brackets

Hand-held portable fire extinguishers, not housed in cabinets, shall be installed on the hangers or brackets supplied. Hangers or brackets shall be securely anchored to the mounting surface in accordance with the manufacturer's installation instructions. (IFC 906.7 2021)	Corrected
--	-----------

18 Door Opening Force

The forces to unlatch doors shall comply with the following: 1. Where door hardware operates by push or pull, the operational force to unlatch the door shall not exceed 15 pounds (66.7 N). 2. Where door hardware operates by rotation, the operational force to unlatch the door shall not exceed 28 inch-pounds (315 N-cm). The force to open doors shall comply with the following: 1. For interior swinging egress doors that are manually operated, other than doors required to be fire rated, the force for pushing or pulling open the door shall not exceed 5 pounds (22 N). 2. For other swinging doors, sliding doors or folding doors, and doors required to be fire rated, the door shall require not more than a 30-pound (133 N) force to be set in motion and shall move to a fullopen position when subjected to not more than a 15-pound (67 N) force. (IFC 1010.1.3 2021)	Corrected
--	-----------

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Brookdale Canyon Lakes	Provider Number 2263
Address 2802 W 35TH AVE ,	Approval Status Disapproved
City, State, Zip Kennewick, WA 99337	Facility Type Residential Care

On 2/11/2026 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

19 Power Source

Exit signs shall be illuminated at all times. To ensure continued illumination for a duration of not less than 90 minutes in case of primary power loss, the sign illumination means shall be connected to an emergency power system provided from storage batteries, unit equipment or an on-site generator. The installation of the emergency power system shall be in accordance with Section 603. Group I-2, Condition 2 exit sign illumination shall not be provided by unit equipment batteries only.

Exception: Approved exit sign illumination types that provide continuous illumination independent of external power sources for a duration of not less than 90 minutes, in case of primary power loss, are not required to be connected to an emergency electrical system.

(IFC 1013.6.3 2021)

Corrected

20 Power Test

Battery-powered emergency lighting equipment shall be tested annually by operating the equipment on battery power for not less than 90 minutes.

(IFC 1031.10.2 2021)

Corrected

21 Maintenance

Emergency and standby power systems shall be maintained in accordance with NFPA 110 and NFPA 111 such that the system is capable of supplying service within the time specified for the type and duration required.

(IFC 1203.4 2021)

Corrected

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Brookdale Canyon Lakes	Provider Number	2263
Address	2802 W 35TH AVE ,	Approval Status	Disapproved
City, State, Zip	Kennewick, WA 99337	Facility Type	Residential Care

On 2/11/2026 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

22 Circuit identification and Accessibility

10.6.5.2 Circuit Identification and Accessibility. 10.6.5.2.1 The location of the branch circuit disconnecting means shall be permanently identified at the control unit. 10.6.5.2.2 System circuit disconnecting means shall be permanently identified as to its purpose in accordance with the following: (1) "FIRE ALARM" for fire alarm systems (2) "EMERGENCY COMMUNICATIONS" for emergency communications systems (3) "FIRE ALARM/ECS" for combination fire alarm and emergency communications systems 10.6.5.2.3 For fire alarm and/or signaling systems, the circuit disconnecting means shall have a red marking. 10.6.5.2.4 The red marking shall not damage the overcurrent protective devices or obscure the manufacturer's markings. 10.6.5.2.5 The circuit disconnecting means shall be accessible only to authorized personnel. 10.6.5.3 Mechanical Protection. The branch circuit(s) and connections shall be protected against physical damage. 10.6.5.4 Circuit Breaker Lock. Where a circuit breaker is the disconnecting means, a listed breaker locking device shall be installed. 10.6.5.5 Overcurrent Protection. An overcurrent protective device of suitable current-carrying capacity that is capable of interrupting the maximum short-circuit current to which it can be subject shall be provided in each ungrounded conductor. (NFPA 72 10.6.5.2)	Corrected
---	-----------

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Brookdale Canyon Lakes	Provider Number	2263
Address	2802 W 35TH AVE ,	Approval Status	Disapproved
City, State, Zip	Kennewick, WA 99337	Facility Type	Residential Care

On 2/11/2026 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

23 Fire Drills

In all Group I, Group E, and Group R2 Occupancies licensed by the state, at least twelve planned and unannounced fire drills shall be held every year. Drills shall be conducted quarterly on each shift in Group I and Group R2, Occupancies and monthly in Group E Occupancies to familiarize personnel with signals and emergency action required under varied conditions. A detailed written record of all fire drills shall be maintained and available for inspection at all times. When drills are conducted between 9:00 p.m. and 6:00 a.m., a coded announcement may be used instead of audible alarms. Fire drills shall include the transmission of a fire alarm signal and simulation of emergency conditions. The fire alarm monitoring company shall be notified prior to the activation of the fire alarm system for drill purposes and again at the conclusion of the transmission and restoration of the fire alarm system to normal mode. (WAC 212-12-044)	Corrected
---	-----------

Next inspection scheduled on or after: 3/13/2026

Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.

Owner or Authorized Representative

Signature

Print Name and Title

Deputy State Fire Marshal Alan Harlan
2803 156TH AVE SE
Bellevue WA 98007
(425) 495-7121

Signature