



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name

7900 Vancouver Mall ,

City, State, Zip

Vancouver, WA 98662

Provider Number 2308

Approval Status Disapproved

Facility Type Residential Care

On 03/05/2025 the Office of the State Fire Marshal conducted a re-inspection at your facility. Listed below are violations that have not been corrected.

Code Requirement

Statement of Violation

1 Inspection and Maintenance

Opening protectives in fire-resistance-rated assemblies shall be inspected and maintained in accordance with NFPA 80. Opening protectives in smoke barriers shall be inspected and maintained in accordance with NFPA 80 and NFPA 105. Openings in smoke partitions shall be inspected and maintained in accordance with NFPA 105. Fire doors and smoke and draft control doors shall not be blocked, obstructed, or otherwise made inoperable. Fusible links shall be replaced promptly whenever fused or damaged. Opening protectives and smoke and draft control doors shall not be modified.

(IFC 705.2 2021)

Facility failed to provide fire door inspection report for all fire doors (missing resident room doors)

Fire doors found throughout with excessive gasps

Claire bridge studio kitchen door found damaged



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name

7900 Vancouver Mall ,

City, State, Zip

Vancouver, WA 98662

Provider Number 2308

Approval Status Disapproved

Facility Type Residential Care

On 03/05/2025 the Office of the State Fire Marshal conducted a re-inspection at your facility. Listed below are violations that have not been corrected.

Code Requirement

Statement of Violation

2Lock and Latches

Locks and latches shall be permitted to prevent operation of doors where any of the following exists:

1. Places of detention or restraint.
2. In buildings in occupancy Group A having an occupant load of 300 or less, Groups B, F, M, and S, and in places of religious worship, the main door or doors are permitted to be equipped with key-operated locking devices from the egress side provided:
 - 2.1. The locking device is readily distinguishable as locked;
 - 2.2. A readily visible sign is posted on the egress side on or adjacent to the door stating: THIS DOOR TO REMAIN UNLOCKED WHEN BUILDING IS OCCUPIED. The sign shall be in letters 1 inch (25 mm) high on a contrasting background; and
 - 2.3. The use of the key-operated locking device is revocable by the building official for due cause.
3. Where egress doors are used in pairs, approved automatic flush bolts shall be permitted to be used, provided that the door leaf having the automatic flush bolts has no doorknob or surface-mounted hardware.
4. Doors from individual dwelling or sleeping units of Group R occupancies having an occupant load of 10 or less are permitted to be equipped with a night latch, dead bolt, or security chain, provided such devices are openable

Signage shall be installed/ updated in accordance with locking arrangement



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name

7900 Vancouver Mall ,

City, State, Zip

Vancouver, WA 98662

Provider Number 2308

Approval Status Disapproved

Facility Type Residential Care

On 03/05/2025 the Office of the State Fire Marshal conducted a re-inspection at your facility. Listed below are violations that have not been corrected.

Code Requirement

Statement of Violation

from the inside without the use of a key or a tool.
5. Fire doors after the minimum elevated temperature has disabled the unlatching mechanism in accordance with listed fire door test procedures.
6. Doors serving roofs not intended to be occupied shall be permitted to be locked preventing entry to the building from the roof.
7. Approved, listed locks without delayed egress shall be permitted in Group I-1 condition 2 assisted living facilities licensed under chapter 388-78A WAC and Group I-1 Condition 2 residential treatment facilities licensed under chapter 246-337 WAC by the state of Washington, provided that:
7.1. The clinical needs of one or more patients require specialized security measures for their safety.
7.2. The doors unlock upon actuation of the automatic sprinkler system or automatic fire detection system.
7.3. The doors unlock upon loss of electrical power controlling the lock or lock mechanism.
7.4. The lock shall be capable of being deactivated by a signal from a switch located in an approved location.
7.5. There is a system, such as a keypad and code, in place that allows visitors, staff persons and appropriate residents to exit. Instructions for exiting shall be posted within six feet of the door.
8. Other than egress courts, where occupants must egress from an exterior space through the building



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name

7900 Vancouver Mall ,

City, State, Zip

Vancouver, WA 98662

Provider Number 2308

Approval Status Disapproved

Facility Type Residential Care

On 03/05/2025 the Office of the State Fire Marshal conducted a re-inspection at your facility. Listed below are violations that have not been corrected.

Code Requirement

Statement of Violation

for means
of egress, exit access doors shall be permitted to be
equipped with an approved locking device where
installed
and operated in accordance with all of the following:
8.1. The occupant load of the occupied exterior area
shall not exceed 300 as determined by IBC Section
1004.
8.2. The maximum occupant load shall be posted
where required by Section 1004.9. Such sign shall
be
permanently affixed inside the building and shall be
posted in a conspicuous space near all the exit
access
doorways.
8.3. A weatherproof telephone or two-way
communication system installed in accordance with
Sections
1009.8.1 and 1009.8.2 shall be located adjacent to
not less than one required exit access door on the
exterior side.
8.4. The egress door locking device is readily
distinguishable as locked and shall be a
key-operated locking
device.
8.5. A clear window or glazed door opening, not less
than 5 square feet (0.46 m2) sq. ft. in area, shall be
provided at each exit access door to determine if
there are occupants using the outdoor area.
8.6. A readily visible durable sign shall be posted on
the interior side on or adjacent to each locked
required
exit access door serving the exterior area stating:
THIS DOOR TO REMAIN UNLOCKED WHEN THE



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name

7900 Vancouver Mall ,

City, State, Zip

Vancouver, WA 98662

Provider Number 2308

Approval Status Disapproved

Facility Type Residential Care

On 03/05/2025 the Office of the State Fire Marshal conducted a re-inspection at your facility. Listed below are violations that have not been corrected.

Code Requirement

Statement of Violation

OUTDOOR AREA IS OCCUPIED. The letters on the sign shall be not less than 1 inch high on a contrasting background.

9. Locking devices are permitted on doors to balconies, decks, or other exterior spaces serving individual dwelling or sleeping units.

10. Locking devices are permitted on doors to balconies, decks, or other exterior spaces of 250 square feet or less, serving a private office space.oor.

(IFC 1010.2.4 2021 WAC 51-54A)

3Admin - (ITM) Inspection, Testing, & Maintenance

Any citation that requires inspection, testing, or maintenance (ITM) is required to have the testing completed, paper results delivered, and any deficiencies found during the ITM corrected before the citation is cleared."

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name

7900 Vancouver Mall ,

City, State, Zip

Vancouver, WA 98662

Provider Number 2308

Approval Status Disapproved

Facility Type Residential Care

On 03/05/2025 the Office of the State Fire Marshal conducted a re-inspection at your facility. Listed below are violations that have not been corrected.

Code Requirement

Statement of Violation

Next inspection scheduled on or after: 04/04/2025

Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.

Owner or Authorized Representative

Nick Fletcher 3/28/2025

Signature

Deputy State Fire Marshal Nicholas Wolden
1823 BAKER WAY
Kelso WA 98626
(360) 852-0966

Nicholas Wolden
Signature



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Brookdale Vancouver Stonebridge	Provider Number	2308
Address	7900 Vancouver Mall ,	Approval Status	Disapproved
City, State, Zip	Vancouver, WA 98662	Facility Type	Residential Care

On 12/30/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

1 Admin - (ITM) Inspection, Testing, & Maintenance

Any citation that requires inspection, testing, or maintenance (ITM) is required to have the testing completed, paper results delivered, and any deficiencies found during the ITM corrected before the citation is cleared."

2 Owner's Responsibility

The owner shall maintain an inventory of all required fire-resistance-rated construction, construction installed to resist the passage of smoke and the construction included in Sections 703 through 707 and Sections 602.4.1 and 602.4.2 of the International Building Code. Such construction shall be visually inspected by the owner annually and properly repaired, restored or replaced where damaged, altered, breached or penetrated. Records of inspections and repairs shall be maintained. Where concealed, such elements shall not be required to be visually inspected by the owner unless the concealed space is accessible by the removal or movement of a panel, access door, ceiling tile or similar movable entry to the space.

(IFC 701.6 2021)

Facility failed to provide annual inspection of fire resistance rated construction

3 Inspection and Maintenance

Opening protectives in fire-resistance-rated assemblies shall be inspected and maintained in accordance with NFPA 80. Opening protectives in smoke barriers shall be inspected and maintained in accordance with NFPA 80 and NFPA 105. Openings in smoke partitions shall be inspected and maintained in accordance with NFPA 105. Fire doors and smoke and draft control doors shall not be blocked, obstructed, or otherwise made inoperable. Fusible links shall be replaced promptly whenever fused or damaged. Opening protectives and smoke and draft control doors shall not be modified.

(IFC 705.2 2021)

Facility failed to provide fire door inspection report for all fire doors (missing resident room doors)

Items found attached to fire doors (Christmas wreaths)

Fire doors found throughout with excessive gasps

Claire bridge studio kitchen door found damaged



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Brookdale Vancouver Stonebridge	Provider Number	2308
Address	7900 Vancouver Mall ,	Approval Status	Disapproved
City, State, Zip	Vancouver, WA 98662	Facility Type	Residential Care

On 12/30/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

4 Duct and Air Transfer Openings - Maintaining Protection

Dampers protecting ducts and air transfer openings shall be inspected and maintained in accordance with NFPA 80 and NFPA 105. Other products or materials used to protect the openings for ducts and air transfer openings shall be securely attached to or bonded to the construction containing the duct or air transfer opening, without visible openings through or into the cavity of the construction. Any damaged products or materials protecting duct and air transfer openings shall be repaired, restored or replaced. (IFC 706.1 2018)	Facility failed to provide fire damper inspection report
---	--

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Brookdale Vancouver Stonebridge	Provider Number	2308
Address	7900 Vancouver Mall ,	Approval Status	Disapproved
City, State, Zip	Vancouver, WA 98662	Facility Type	Residential Care

On 12/30/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

5 Commercial Cooking Systems

904.13 Commercial cooking systems. The automatic fire-extinguishing system for commercial cooking systems shall be of a type recognized for protection of commercial cooking equipment and exhaust systems of the type and arrangement protected. Preengineered automatic dry- and wet-chemical extinguishing systems shall be tested in accordance with UL 300 and listed and labeled for the intended application. Other types of automatic fireextinguishing systems shall be listed and labeled for specific use as protection for commercial cooking operations. The system shall be installed in accordance with this code, NFPA 96, its listing and the manufacturer's installation instructions. Additional protection is not required for ductwork beyond 75 feet when hood suppression system complies with UL 300. Signage shall be provided on the exhaust hood or system cabinet, indicating the type and arrangement of cooking appliances protected by the automatic fire-extinguishing system. Signage shall indicate appliances from left to right, be durable, and the size, color, and lettering shall be approved. Automatic fireextinguishing systems of the following types shall be installed in accordance with the referenced standard indicated, as follows:

1. Carbon dioxide extinguishing systems, NFPA 12.
2. Automatic sprinkler systems, NFPA 13.
3. Automatic water mist systems, NFPA 750.
4. Foam-water sprinkler system or foam-water spray systems, NFPA 16.
5. Dry-chemical extinguishing systems, NFPA 17.
6. Wet-chemical extinguishing systems, NFPA 17A.

EXCEPTIONS:

1. Factory-built commercial cooking recirculating systems that are tested in accordance with UL 710B and listed, labeled and installed in accordance with Section 304.1 of the International Mechanical Code.
2. Protection of duct systems beyond 75 feet when the commercial kitchen exhaust hood is protected by a system listed in accordance with UL 300.

(IFC 904.13 2021 WAC 51-54A)

Signage shall be provided on the exhaust hood or system cabinet, indicating the type and arrangement of cooking appliances protected by the automatic fire-extinguishing system. Signage shall indicate appliances from left to right, be durable, and the size, color, and lettering shall be approve



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Brookdale Vancouver Stonebridge	Provider Number	2308
Address	7900 Vancouver Mall ,	Approval Status	Disapproved
City, State, Zip	Vancouver, WA 98662	Facility Type	Residential Care

On 12/30/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

6 Operations and Maintenance

Automatic fire-extinguishing systems protecting commercial cooking systems shall be maintained in accordance with Sections 904.13.5.1 through 904.13.5.3.

(IFC 904.13.5 2021)

Facility shall submit appliance modifications that have been made to the City of Vancouver as cooking appliances have changed possibly affecting suppression system design.

New heat survey shall be completed due to change in appliance selection.

7 Portable Fire Extinguishers - General Requirements

Portable fire extinguishers shall be selected, installed and maintained in accordance with this section and NFPA 10.

Exceptions:

1. The distance of travel to reach an extinguisher shall not apply. The travel distance to reach an extinguisher shall not apply to the spectator seating portions of Group A-5 occupancies.
2. Thirty-day inspections shall not be required and maintenance shall be allowed to be once every three years for dry-chemical or halogenated agent portable fire extinguishers that are supervised by a listed and approved electronic monitoring device, provided that all of the following conditions are met:
 - 2.1. Electronic monitoring shall confirm that extinguishers are properly positioned, properly charged and unobstructed.
 - 2.2. Loss of power or circuit continuity to the electronic monitoring device shall initiate a trouble signal.
 - 2.3. The extinguishers shall be installed inside of a building or cabinet in a noncorrosive environment.
 - 2.4. Electronic monitoring devices and supervisory circuits shall be tested every 3 years when extinguisher maintenance is performed.
 - 2.5. A written log of required hydrostatic test dates for extinguishers shall be maintained by the owner to verify that hydrostatic tests are conducted at the frequency required by NFPA 10.
3. In Group I-3, portable fire extinguishers shall be permitted to be located at staff locations.

(IFC 906.2 2021)

Portable fire extinguisher found at front entrance blocked by Christmas tree



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Brookdale Vancouver Stonebridge	Provider Number	2308
Address	7900 Vancouver Mall ,	Approval Status	Disapproved
City, State, Zip	Vancouver, WA 98662	Facility Type	Residential Care

On 12/30/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

8 Maintenance

Carbon monoxide alarms and carbon monoxide detection systems shall be maintained in accordance with NFPA 72. Carbon monoxide alarms and carbon monoxide detectors that become inoperable or begin producing end-of-life signals shall be replaced. (IFC 915.6 2021 WAC)	Monthly carbon monoxide detector testing shall be provided
--	--

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Brookdale Vancouver Stonebridge	Provider Number	2308
Address	7900 Vancouver Mall ,	Approval Status	Disapproved
City, State, Zip	Vancouver, WA 98662	Facility Type	Residential Care

On 12/30/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

9 Lock and Latches

Locks and latches shall be permitted to prevent operation of doors where any of the following exists:

1. Places of detention or restraint.
2. In buildings in occupancy Group A having an occupant load of 300 or less, Groups B, F, M, and S, and in places of religious worship, the main door or doors are permitted to be equipped with key-operated locking devices from the egress side provided:
 - 2.1. The locking device is readily distinguishable as locked;
 - 2.2. A readily visible sign is posted on the egress side on or adjacent to the door stating: THIS DOOR TO REMAIN UNLOCKED WHEN BUILDING IS OCCUPIED. The sign shall be in letters 1 inch (25 mm) high on a contrasting background; and
 - 2.3. The use of the key-operated locking device is revocable by the building official for due cause.
3. Where egress doors are used in pairs, approved automatic flush bolts shall be permitted to be used, provided that the door leaf having the automatic flush bolts has no doorknob or surface-mounted hardware.
4. Doors from individual dwelling or sleeping units of Group R occupancies having an occupant load of 10 or less are permitted to be equipped with a night latch, dead bolt, or security chain, provided such devices are operable from the inside without the use of a key or a tool.
5. Fire doors after the minimum elevated temperature has disabled the unlatching mechanism in accordance with listed fire door test procedures.
6. Doors serving roofs not intended to be occupied shall be permitted to be locked preventing entry to the building from the roof.
7. Approved, listed locks without delayed egress shall be permitted in Group I-1 condition 2 assisted living facilities licensed under chapter 388-78A WAC and Group I-1 Condition 2 residential treatment facilities licensed under chapter 246-337 WAC by the state of Washington, provided that:
 - 7.1. The clinical needs of one or more patients require specialized security measures for their safety.
 - 7.2. The doors unlock upon actuation of the automatic sprinkler system or automatic fire detection system.

Signage shall be installed/ updated in accordance with locking arrangement



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Brookdale Vancouver Stonebridge	Provider Number	2308
Address	7900 Vancouver Mall ,	Approval Status	Disapproved
City, State, Zip	Vancouver, WA 98662	Facility Type	Residential Care

On 12/30/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
7.3. The doors unlock upon loss of electrical power controlling the lock or lock mechanism. 7.4. The lock shall be capable of being deactivated by a signal from a switch located in an approved location. 7.5. There is a system, such as a keypad and code, in place that allows visitors, staff persons and appropriate residents to exit. Instructions for exiting shall be posted within six feet of the door. 8. Other than egress courts, where occupants must egress from an exterior space through the building for means of egress, exit access doors shall be permitted to be equipped with an approved locking device where installed and operated in accordance with all of the following: 8.1. The occupant load of the occupied exterior area shall not exceed 300 as determined by IBC Section 1004. 8.2. The maximum occupant load shall be posted where required by Section 1004.9. Such sign shall be permanently affixed inside the building and shall be posted in a conspicuous space near all the exit access doorways. 8.3. A weatherproof telephone or two-way communication system installed in accordance with Sections 1009.8.1 and 1009.8.2 shall be located adjacent to not less than one required exit access door on the exterior side. 8.4. The egress door locking device is readily distinguishable as locked and shall be a key-operated locking device. 8.5. A clear window or glazed door opening, not less than 5 square feet (0.46 m2) sq. ft. in area, shall be provided at each exit access door to determine if there are occupants using the outdoor area. 8.6. A readily visible durable sign shall be posted on the interior side on or adjacent to each locked required exit access door serving the exterior area stating: THIS DOOR TO REMAIN UNLOCKED WHEN THE OUTDOOR AREA IS OCCUPIED. The letters on the sign shall be not less than 1 inch high on a contrasting background. 9. Locking devices are permitted on doors to balconies, decks, or other exterior spaces serving individual dwelling or sleeping units. 10. Locking devices are permitted on doors to balconies,	



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Brookdale Vancouver Stonebridge	Provider Number	2308
Address	7900 Vancouver Mall ,	Approval Status	Disapproved
City, State, Zip	Vancouver, WA 98662	Facility Type	Residential Care


On 12/30/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
decks, or other exterior spaces of 250 square feet or less, serving a private office space.oor. (IFC 1010.2.4 2021 WAC 51-54A)	

Next inspection scheduled on or after: 01/29/2025

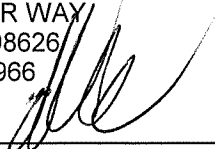
Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.

Owner or Authorized Representative


Signature

Jason T. Collins
Print Name and Title

Deputy State Fire Marshal Nicholas Wolden
1823 BAKER WAY
Kelso WA 98626
(360) 852-0966


Signature