




Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

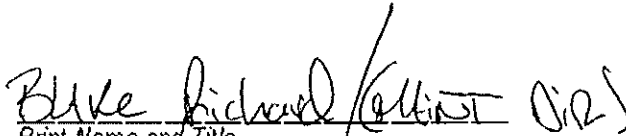
Business Name	Brookdale Olympia West	Provider Number	2497
Address	420 YAUGER WAY SW,	Approval Status	Approved
City, State, Zip	Olympia, WA	Facility Type	Residential Care

On 02/02/2026 the Office of the State Fire Marshal conducted an inspection at your facility.


All violations noted during previous related inspection(s) have been corrected.

Owner or Owner's Representative


Signature


Print Name and Title

Deputy State Fire Marshal Raul Murcia
PO BOX 42642
Olympia WA 98504
(360) 819-0067


Signature

This document was prepared by Residential Care Services for the Locator website.

Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.



Washington State Patrol
Fire Protection Bureau
Phone (360) 596-3900

Business Name	Brookdale Olympia West	Provider Number	2497
Address	420 YAUGER WAY SW,	Approval Status	Disapproved
City, State, Zip	Olympia, WA	Facility Type	Residential Care

On 10/08/2025 the Office of the State Fire Marshal conducted an inspection at your facility

Code Requirement

Statement of Violation

1 Equipment Rooms

Combustible material shall not be stored in boiler rooms, mechanical rooms, electrical equipment rooms or in fire command centers as specified in Section 508.1.5.

(IFC 315.2.3 2021)

Findings during the inspection were

Electrical room located by kitchen had various combustible materials that need to be removed.

2 Duct and Air Transfer Openings - Maintaining Protection

Dampers protecting ducts and air transfer openings shall be inspected and maintained in accordance with NFPA 80 and NFPA 105. Other products or materials used to protect the openings for ducts and air transfer openings shall be securely attached to or bonded to the construction containing the duct or air transfer opening, without visible openings through or into the cavity of the construction. Any damaged products or materials protecting duct and air transfer openings shall be repaired, restored or replaced.

(IFC 706.1 2018)

Findings during the inspection were:

Fire/smoke damper report from 1/8/2025 states 14 dampers failed. Need report showing damper have been corrected.

3 Testing and Maintenance

Sprinkler systems shall be tested and maintained in accordance with Section 901.

(IFC 903.5 2021)

Findings during the inspection were

Facility failed to provide documentation showing annual forward flow test for the backflow. Report should state if it passed or failed.

4 Emergency Lighting Equipment Inspection and Testing

Emergency lighting shall be maintained in accordance with Section 1008 and shall be inspected and tested in accordance with Sections 1031.10.1 and 1031.10.2

(IFC 1032.10 2021)

Findings during the inspection were:

The following exits signs failed to operate when tested

-By room F1

-By room B8 inside emergency exit area.



Washington State Patrol
Fire Protection Bureau
Phone (360) 596-3900

Business Name	Brookdale Olympia West	Provider Number	2497
Address	420 YAUGER WAY SW,	Approval Status	Disapproved
City, State, Zip	Olympia, WA	Facility Type	Residential Care

On 10/08/2025 the Office of the State Fire Marshal conducted an inspection at your facility.


Code Requirement

Statement of Violation

Next inspection scheduled on or after: 11/13/2025


Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12

Owner or Authorized Representative


Signature

Blake Richard / (Mint D.R.)
Print Name and Title

Deputy State Fire Marshal Raul Murcia
PO BOX 42642
Olympia WA 98504
(360) 819-0067


Signature